

Courtesy Safety Notice: COBRA buckles



Dear valued clients,


it has come to our attention that in an extremely small quantity (0.00005% = 1 out of 2 million) of COBRA buckles there may exist parts where the rivets have **not** been **press fixed**.

This results in the rivets being loose and the release clips detach. COBRA buckles in all different versions and sizes can be affected. As we are dedicated to the 100% function, performance, quality and safety of our products, we ask all our clients and end users of COBRA buckles to **do a visual check**:




Former products:	Still in production:
W0036 Sit worker speed	W0021 Strike
W0522 Operator	W0050 Tarzan
W0042 Profi worker speed	C5036 Tarzan light
W0067 Sit worker II speed	
W0045 Expert II speed	
W0051 Energetic	
W0033 Seamaster	
W0058 Seamaster II	

DO A VISUAL CHECK

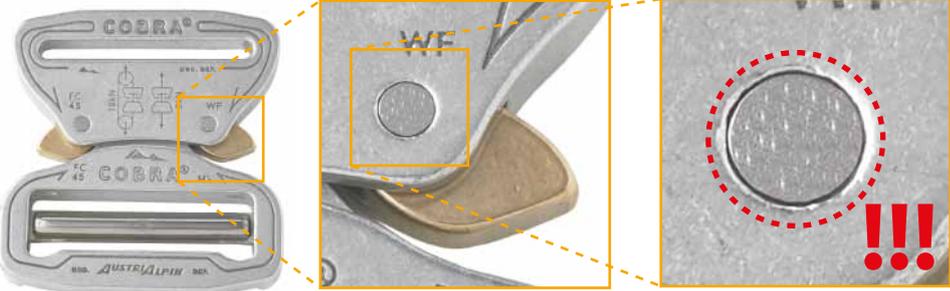

NOT Correct
The rivet does not show any circular embossing

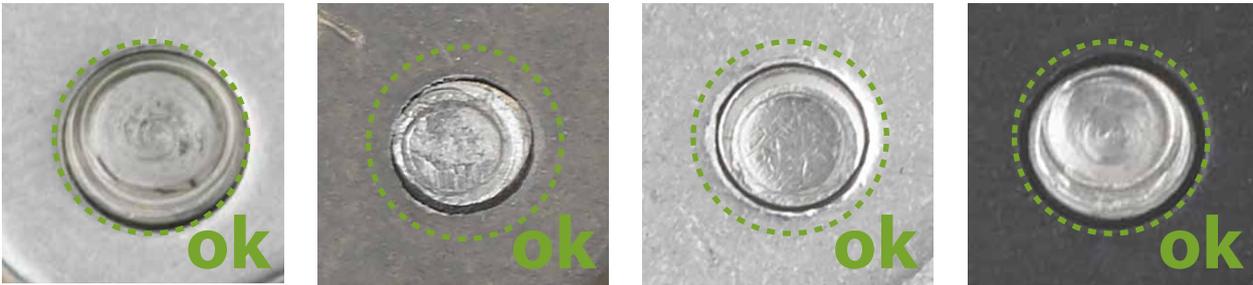

Correct
The rivet shows an embossing in the form of a ring on both the front and back sides of the rivet.
Do not manipulate the rivets by mechanical action.

If you notice a buckle that is NOT riveted or you do have any concerns, STOP USING the product immediately and get in contact with us: info@singingrock.com or via phone +420 481 585 007

We would like to apologize for the inconvenience and are kindly asking for your understanding.

SINGING ROCK TEAM